


Wednesday, May 15, 2013 15:04:46

THIS DOCUMENT AND THE INFORMATION
IT CONTAINS IS THE PROPERTY OF EMTED INC.
AND MAY NOT BE USED IN ANY WAY WITHOUT
THE EXPRESS WRITTEN CONSENT OF EMTED INC.

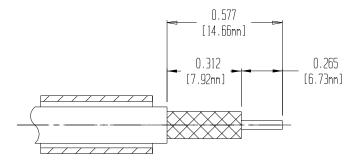

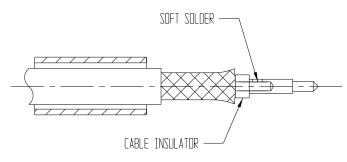

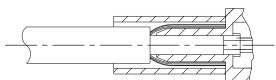

DANITELS

MIL COLC

	MIL-75F	DANIEL2		
CABLE TYPE	HEX DIE P/N	HEX DIE P/N	HEX ZIDE	SOLDER TEMPERATURE
PFLX175-075-XX	M22520/5-43	Y141	В	700-750 ° F (371-398 ° C)
RG-142 B/U	M22520/5-19	Y142	В	700-750 ° F (371-398 ° C)
PFLX140-XXX	M22520/5-41	Y140	В	700-750 ° F (371-398 ° C)
PFLX190-075-XX	M22520/5-19	Y142	В	700-750 ° F (371-398 ° C)
PFLX195-XXX	M22520/5-19	Y142	В	700-750 ° F (371-398 ° C)
PFLX200-XXX	M22520/5-19	Y142	В	700-750 ° F (371-398 ° C)
PFLX240-XXX	M22520/5-43	Y141	A	700-750 ° F (371-398 ° C)
PFLX340-XXX	M22520/5-35	Y137	A	750-800 ° F (398-427 ° C)
PFLX400-XXX	M22520/5-61	Y178	A	800-850 ° F (427-454 ° C)
PFLX500-XXX	M22520/5-21	Y149	A	800-850 ° F (427-454 ° C)
TFLX125-075-XX	M22520/5-41	Y140	В	700-750 ° F (371-398 ° C)
TFLX130-XXX	M22520/5-41	Y140	В	700-750 ° F (371-398 ° C)
TFLX165-XXX	M22520/5-19	Y142	В	700-750 ° F (371-398 ° C)
TFLX205-XXX	M22520/5-43	Y141	A	700-750 ° F (371-398 ° C)
TFLX225-XXX	M22520/5-43	Y141	A	700-750 ° F (371-398 ° C)
TFLX295-XXX	M22520/5-35	Y137	A	750-800 ° F (398-427 ° C)
TFLX480-XXX	M22520/5-27	Y151	A	800-850 ° F (427-454 ° C)

F	Œν	REVISION	DATE	ER #	INTL
1	Е	UPDATED PART NUMBERS IN INSRTUCTIONS	02/01/2007	6454	CCE
	F	ADDED PFLX190-075 TO CABLE TYPE LIST	08/31/2009	10064	VML
G		* NOTE WAS 'FLX140-500'	05/15/2013	0501-13	ASL

ES-105-1
CABLE ASSEMBLY INSTRUCTIONS

- 1.) SLIDE DN ANY HEAT SHRINK LABELS IF USED, THEN THE BLACK ADHESIVE HEAT SHRINK AND THEN THE CRIMP TUBE.
- 2.) STRIP THE CABLE PER THE DIMENSIONS SHOWN. REMOVE THE MATERIALS.
- 3.) INSTALL THE CABLE INSULATOR ONTO THE CENTER CONDUCTOR BUTTING IT UP AGAINST THE CABLE DIELECTRIC.
- 4.) TIN THE CENTER CONDUCTOR, THEN SOLDER THE CONTACT ONTO THE CENTER CONDUCTOR, BUTTING THE CONTACT UP AGAINST THE CABLE INSULATOR, LEAVING NO GAPS. CAUTION: DO NOT OVERHEAT THE CONTACT AND SWELL THE DIELECTRIC AND/OR INSULATOR. SEE CHART FOR RECOMMENDED SOLDER TEMPERATURES.
- 5.) FLARE THE OUTER SHIELD BRAID BY GENTLY ROTATING THE CONTACT AND DIELECTRIC, THEN FINISH TO FLARE OUT, NOT DISTURBING THE INNER FOIL SHIELD. DO NOT REMOVE THE ALUMINUM MYLAR FOIL INNER SHIELD FROM THE DIELECTRIC.
- 6.) INSERT THE CONTACT INTO THE REAR OF THE CONNECTOR BODY, THE INNER SHIELD BEING INSIDE OF THE CONNECTOR BODY AND THE BRAID SHIELD DUTSIDE, UNTIL THE CONTACT SNAPS INTO PLACE. SLIDE THE CRIMP TUBE UP OVER THE BRAID AND UP AGAINST THE CONNECTOR BODY. CRIMP USING M22520/5-01 (HX4) CRIMPING TOOL WITH APPROPRIATE DIE. SEE CHART.
- 7.) SLIDE BLACK ADHESIVE HEAT SHRINK UP OVER REAR END OF CONNECTOR BODY (EXCLUDING ARINC CONNECTOR'S) AND HEAT SHRINK. FOR ARINC CONNECTOR'S, SLIDE UP TO REAR OF CONNECTOR BODY AND HEAT SHRINK.
- * NDTE: WHEN TERMINATING RG-142, RG400, PFLX140-500, OR PFLX200-XXX, USE THE GOLD CRIMP TUBE SUPPLIED. WHEN TERMINATING PFLX195-500, OR TFLX130-100, USE THE SILVER CRIMP TUBE SUPPLIED.

DATE 03/26/2001 DRAWN A. SWENSON	5349 S. EMMER DRIVE NEW BERLIN, WI 53151 (888) 679-6170	
CHECKED 05/14/2013	CABLE STRIPPING INSTRUCTIONS	
APPROVED 05/14/2013 K.BACHLEDA	CAGE CODE DWG # ES-105-1	SHT L